



1. Apply Bonding Adhesive to the clean substrate and to the back of the membrane flashing. Allow to flash off. Apply Water Stop in a 3/8" wide bead along vertical edge where membrane will be terminated. Keep Water Stop bead 1/2" in from edge of membrane.

2. Install membrane and embed edge into bead of Water Stop.

3. Install any metal edging and prime with All Purpose Primer, using scrub pad and handle.

4. Once Primer has flashed off, mate the flashing to the primed metal, while keeping the flashing edge aligned with the metal edge. Hand roll.

5. Align Termination Bar with the edge of the membrane and drill the required holes to accept the appropriate fastener of your choosing. Fastener spacing should not exceed 12" on center. Apply All Purpose Sealant to lip of the Termination Bar.

Note: Peel and Stick TPO membrane has factory applied adhesive on the back of the sheet, eliminating the need for application of Bonding Adhesive as shown above. In lieu of applying Bonding Adhesive to the substrates, apply All Purpose Primer, and allow it to flash off completely prior to installing the Peel and Stick TPO membrane.

D

Vertical Termination Bar Installation

