


1

See detail F "Seam Assembly" for instructions on assembling a spliced membrane seam. Then continue steps 2 through 7 of this detail


2

Assembled T-Joint

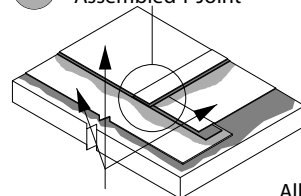

Membrane Panels


3

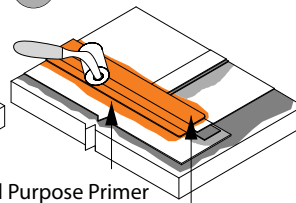

All Purpose Primer

Peel & Stick Cover Tape


4

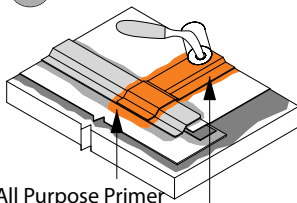

All Purpose Primer


Peel & Stick Cover Tape

5

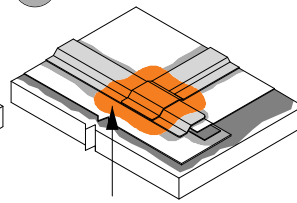


All Purpose Primer

6

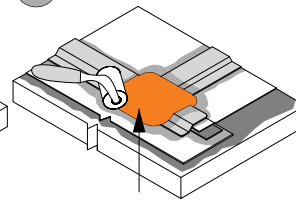

T-Joint Cover

7

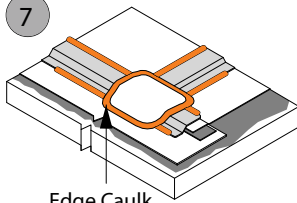

Edge Caulk

Note: Peel and Stick TPO membrane has factory applied adhesive on the back of the sheet, eliminating the need for application of Bonding Adhesive as shown above. In lieu of applying Bonding Adhesive to the substrates, apply All Purpose Primer, and allow it to flash off completely prior to installing the Peel and Stick TPO membrane. For membrane to membrane bonds, apply All Purpose Primer to bottom sheet as indicated above.

1. See Detail F "Seam Assembly".

2. Install and seam field sheets. Important: Please see "Seam Assembly" for instructions on installing and seaming membrane panels.

3. With scrub pad & handle, apply All Purpose Primer to field seam. Allow primer to flash off, and then apply Cover Tape. Hand roll to ensure adhesion.

4. With scrub pad & handle, apply All Purpose Primer to field seam and to installed Cover Tape at intersection. Allow primer to flash off, and then apply Cover Tape. Hand roll to ensure adhesion.

5. Apply All Purpose Primer to T-Joint area, extending 5" from center of T-Joint in all directions. Allow to flash off.

6. Using template supplied in the Accessory Kit, cut a T-Joint cover from Peel & Stick Flashing. Alternately, you may use a Peel & Stick Corner as a T-Joint cover. Remove release liner and apply T-Joint Cover, centered over T-Joint. Begin in the center, and smooth outward to avoid wrinkles or bubbles. Hand roll cover..

7. Apply Edge Caulk to all flashing and seam edges. This includes the T-Joint cover edges and the Cover Tape edges.

K

T-Joint Cover

